

DATE _____

Sheet 1 of 4 Sheets

**ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(C), LOTS 1 THROUGH 5
(P.L. 92-203, 85 STAT. 703)
EKWOK NATIVES, LIMITED**

EKWOK, ALASKA

AND

THE RETRACEMENT OF PORTIONS OF
U.S. SURVEY NOS. 4878 AND 7733, LOT 2, AND
THE SUBDIVISION OF TRACT B
U.S. SURVEY NO. 4878
INTO (ANCSA) 14(C) LOTS 3, 4, AND 5 AND
THE SURVEY OF (ANCSA) 14(C) LOTS 1 AND 2

This plat contains the entire survey record.

The exterior boundaries of Townships 9 and 10 South,
Ranges 48 and 49 West, Seward Meridian, Alaska, were
surveyed by Timothy A. Kent, Cadastral Surveyor, in 1978.

U.S. Survey No. 3867 was surveyed by Robert Q.
Pickering, Supervisory Cadastral Surveyor, in 1962.

U.S. Survey No. 4878 was surveyed by Edward D. Conklin,
Supervisory Cadastral Surveyor, in 1967.

U.S. Survey Nos. 7733, Lot 2, and 7954 were surveyed
concurrently by Willard M. Olson and Douglas R. Gardner,
Cadastral Surveyors, respectively, in 1987.

U.S. Survey No. 8149 was surveyed by Christopher D.
Wiita, Cadastral Surveyor, in 1987.

This survey was executed by Carl B. Lyon, Cadastral
Surveyor, September 4 through October 10, 1987, in
accordance with the specifications set forth in the
Manual of Surveying Instructions, 1973; (ANCSA) 14(c)
Ekwok Plan of Survey approved February 17, 1987; and
Assignment Instructions dated August 17, 1987.

Field assistants were:

Christopher D. Wiita, Cadastral Surveyor
Daniel A. Wiesner, Student Trainee (LS)
Eugene R. Malesky, Surveying Technician
Kent D. Carlson, Surveying Aid

Area: 1431.64 Acres.

The azimuth was obtained from line 2-3, U.S. Survey
No. 3867, identical with line 11-12, Lot 4, a direct
observation of the sun, using the hour angle method, and
refers to the true meridian.

The approximate geographic position of the witness
corner to corner No. 1, Block 12, Tract A, U.S. Survey
No. 4878, identical with the witness corner to corner
No. 13, Lot 1, is:

Latitude: 59°21.29' North
Longitude: 157°27.42' West
NAD 27

The mean magnetic declination was taken from the field
notes of the dependent resurvey of U.S. Survey No. 4878.

This survey is located on a plateau, 30 feet high. The
land is well-drained and covered with spruce and birch
timber. The eastern half of Lot 1 is situated on the
plateau; the western half slopes down to the Nushagak
River bottom with an undergrowth of scattered scrub
spruce and birch, alder, and devil's club.

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Anchorage, Alaska

The survey represented by this plat, having been
properly executed and examined, is hereby accepted
for having fulfilled the intent of Section 14(c) of
the Alaska Native Claims Settlement Act.

For the Director

Must C. Lyons May 16, 1989
Deputy State Director for Cadastral Survey, Alaska
Acting

MEANDERS

ALONG A WELL-DEFINED BANK, 6 TO 200 FT. HIGH,
AT THE LINE OF ORDINARY HIGH WATER.

1. N. 70°26' E. 194.97	2.9541 CHS.
2. N. 86°13' E. 754.10	11.4258 CHS.
3. N. 76°35' E. 1116.54	16.9173 CHS.
4. N. 50°01' E. 607.61	9.2062 CHS.
5. N. 24°40' E. 557.10	8.4409 CHS.
6. N. 17°14' E. 297.60	4.5091 CHS.
7. N. 41°51' E. 549.89	5.3013 CHS.
8. N. 63°47' E. 253.21	3.8365 CHS.
9. N. 58°41' E. 674.48	10.2194 CHS.
10. N. 52°26' E. 123.52	1.8714 CHS.

I hereby certify that the lots, 1 through 5,
of land represented on this plat of survey
are Interim Conveyed to the Ekwok Natives,
Limited, by Interim Conveyance No. 178
issued by the United States of America; said
lots also fulfill all entitlements under the
provisions of ANCSA 14(c) for the Ekwok
Natives, Limited, as shown on the ANCSA
14(c) Ekwok Plan of Survey approved
February 17, 1987.

Date _____

President
Ekwok Natives, Limited


Original Plat signed by:

Luki Akelkok, Sr. - President

EKWOK NATIVES LIMITED


April 29, 1989

(signature did not reproduce
to duplicate-original plats)

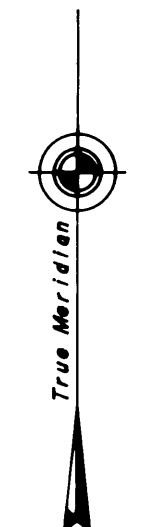

Mean
Magnetic
Declination
21 1/2° E.


W.C.M.C. N. 0°03' W. 124.17 (1.8814 CHS.)

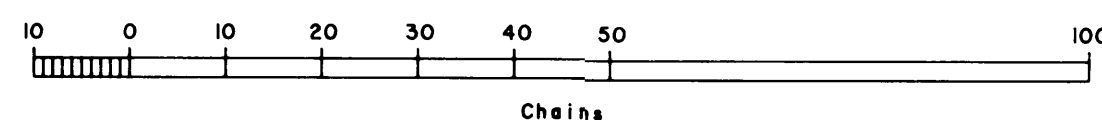

I, Carl B. Lyon, Cadastral Surveyor, HEREBY CERTIFY upon honor
that in pursuance of (ANCSA) 14(c) Ekwok Plan of Survey approved
February 17, 1987, I have executed the survey depicted on this
plat in strict conformity with the Plan of Survey, the Manual of
Instructions for the Survey of the Public Lands of the United
States, 1973, and in the specific manner described on this plat.


9-10-89
Date

Carl B. Lyon
Cadastral Surveyor



ENLARGED DIAGRAM "A"

89-7
RECORDED - FILED 35
Bristol Bay REC. DIST.
DATE 5-18 1989
TIME 3:10 P.M.
Remitted by
Address USA/BLM




DATE _____


Sheet 2 of 4 Sheets

ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(C), LOTS 1 THROUGH 5
(P.L. 92-203, 85 STAT. 703)
EKWOK NATIVES, LIMITED

EKWOK, ALASKA

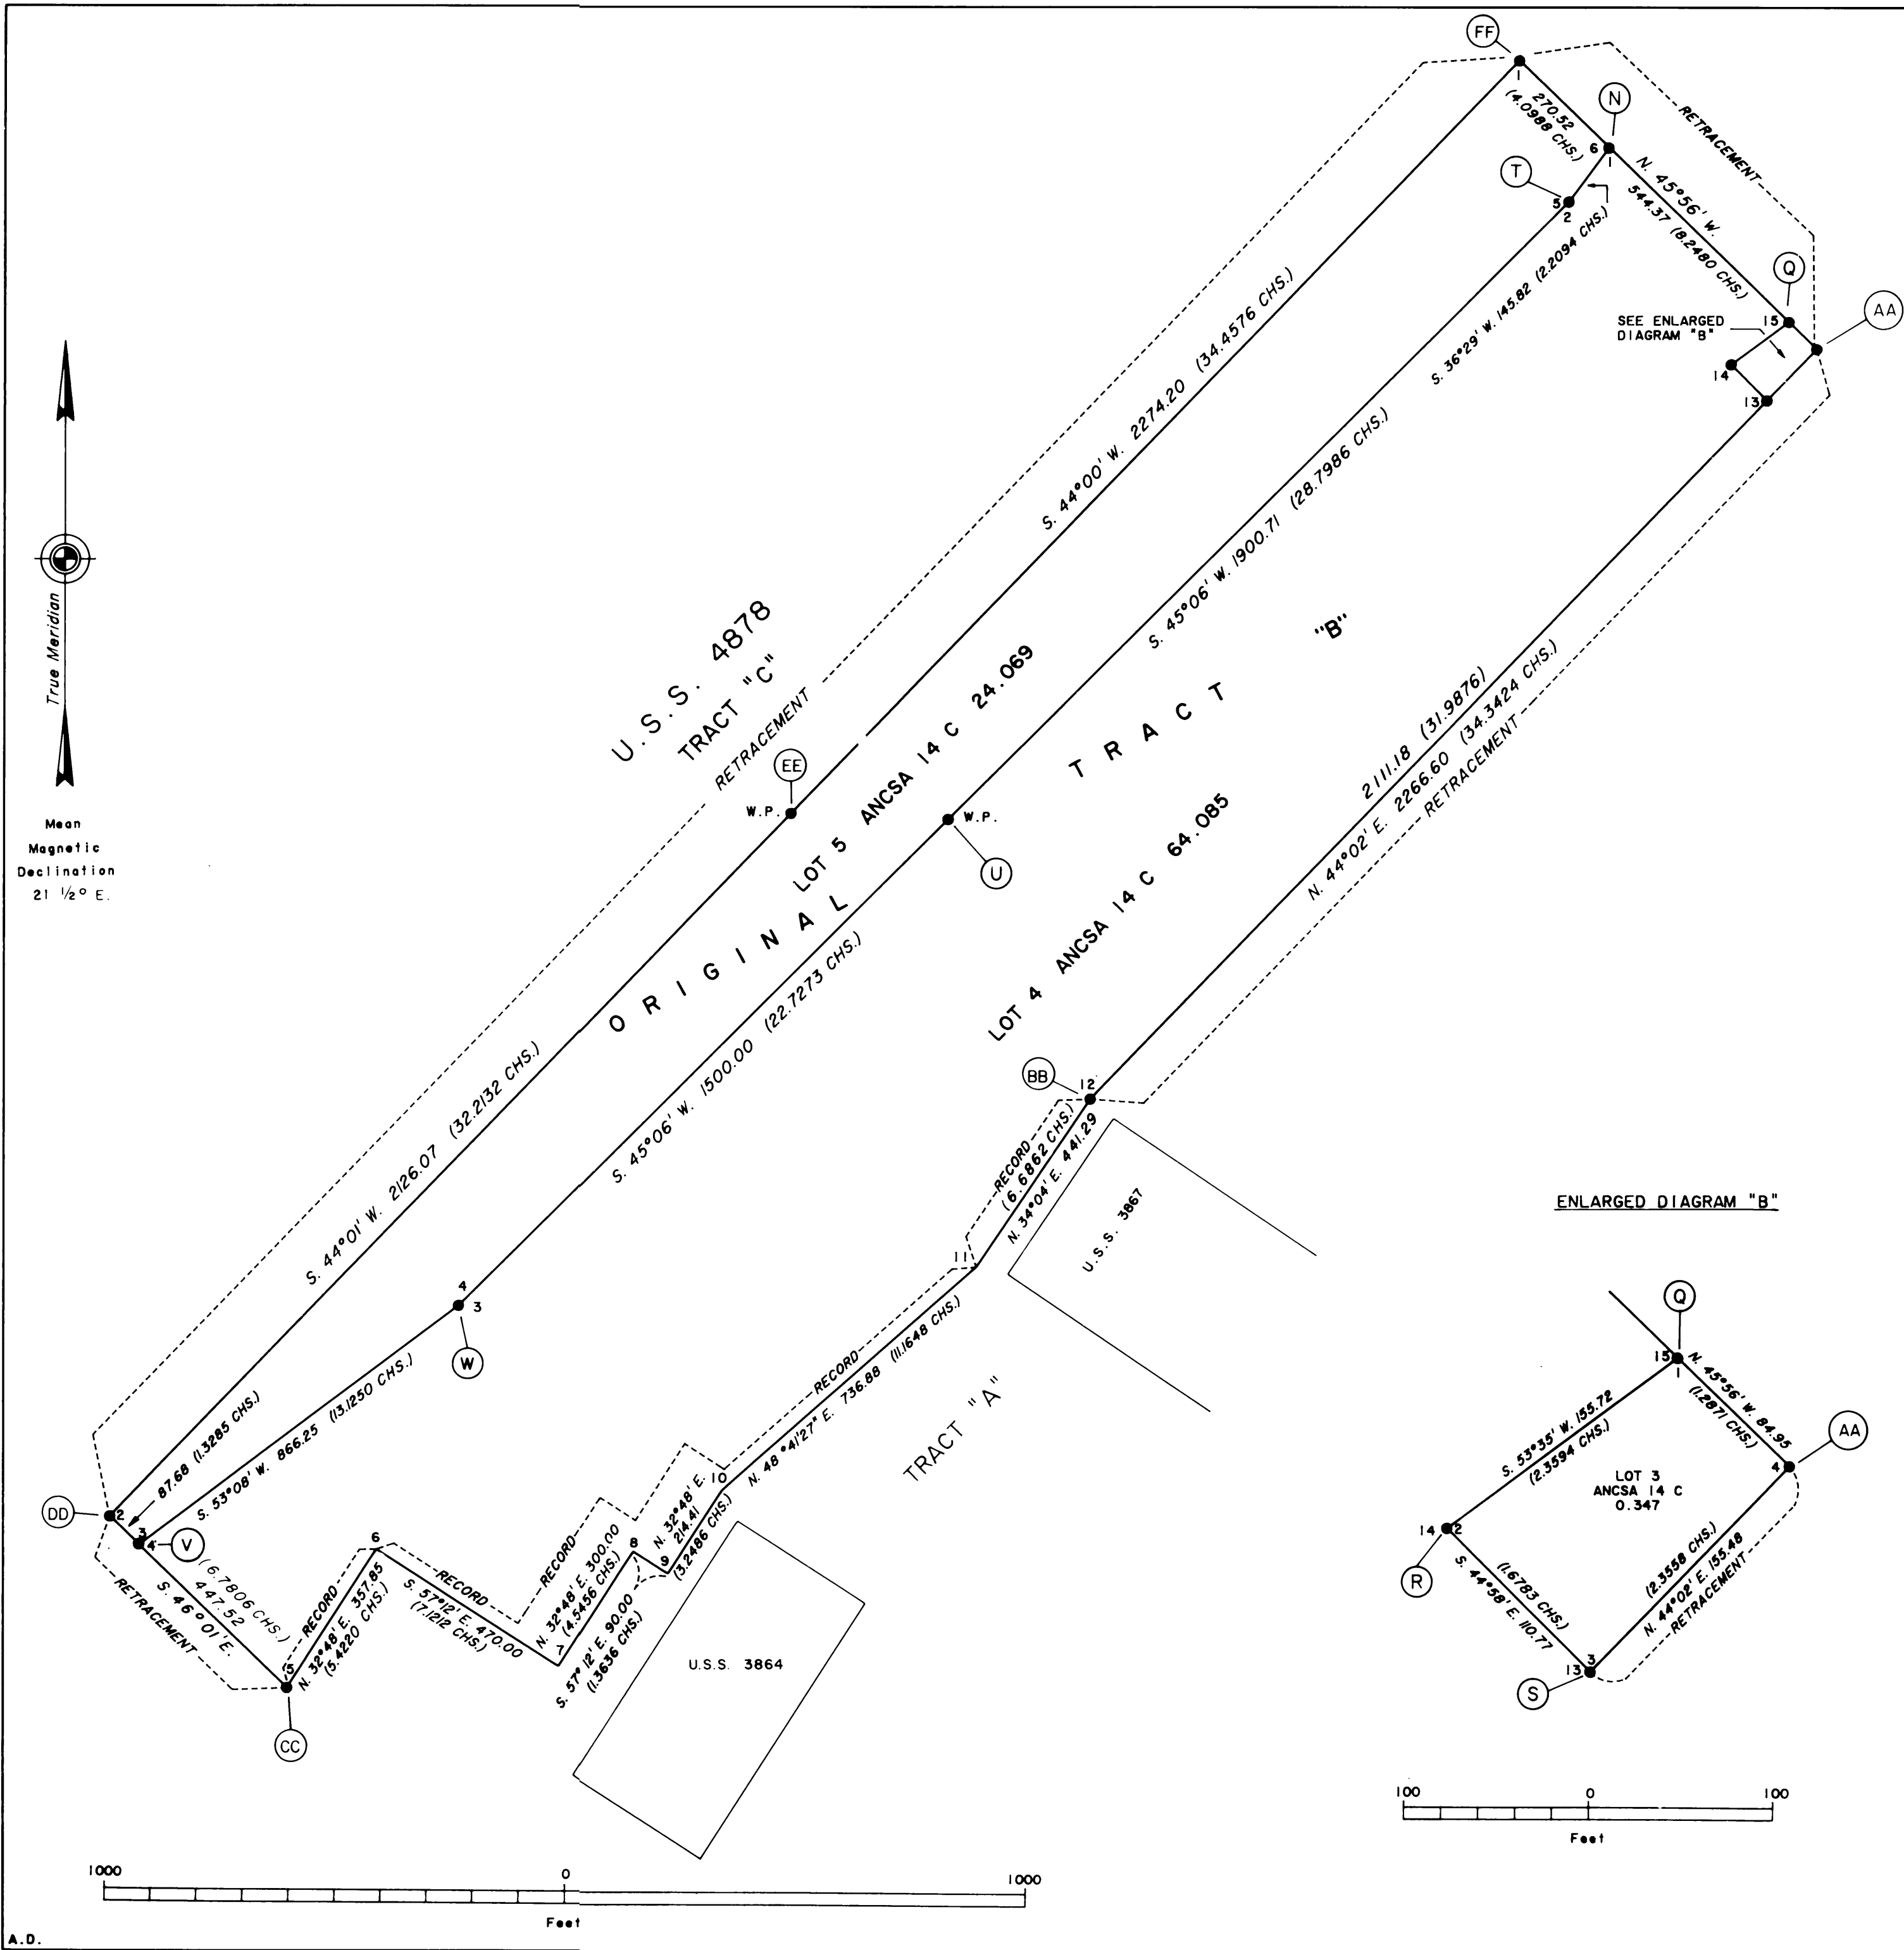

ENLARGED DIAGRAM "B"

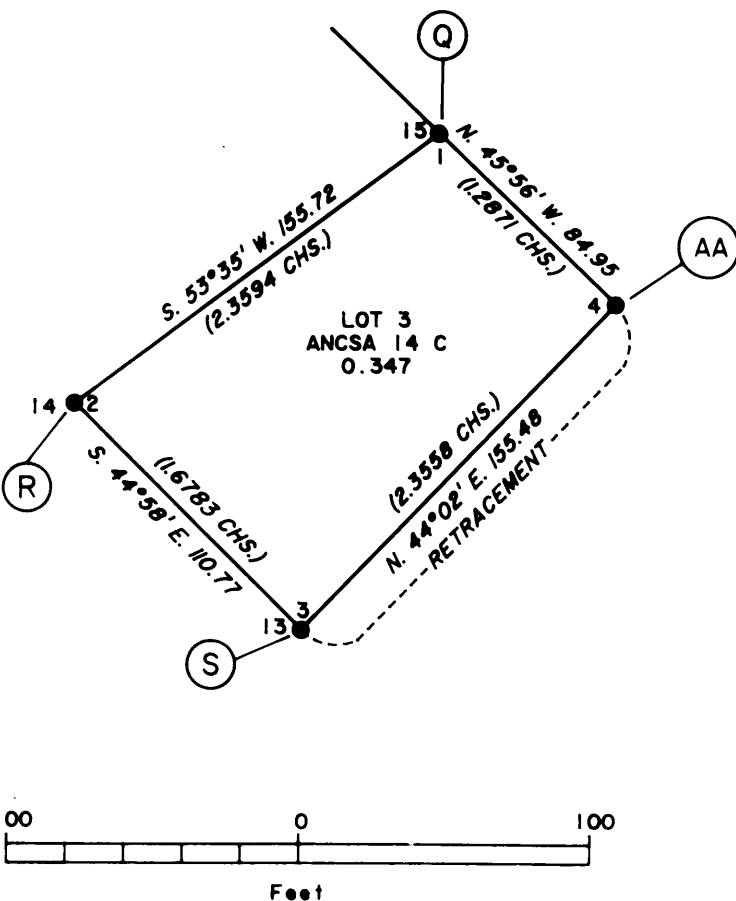

89-7

RECORDED - FILED	35cc
Bristol Bay REC. DIST.	
DATE	5-18 1989
TIME	3:10 P.M.
Examined by	DSA/ALM
Address	

REFERENCE SHOULD BE MADE
TO
SHEET NO. 1
FOR SURVEY INFORMATION

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Anchorage, Alaska

The survey represented by this plat, having been properly executed and examined, is hereby accepted for having fulfilled the intent of Section 14(c) of the Alaska Native Claims Settlement Act.

For the Director


Manly 1989
Date
Deputy State Director for Cadastral Survey,
Alaska
ACTING

DATE _____

Sheet 3 of 4 Sheets

ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(C), LOTS 1 THROUGH 5
(P.L. 92-203, 85 STAT. 703)
EKWOK NATIVES, LIMITED


EKWOK, ALASKA

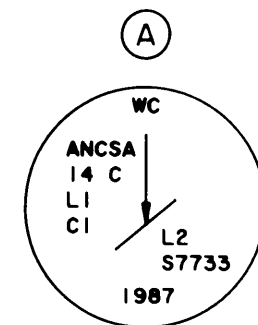

Set an alum. post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with alum. cap mkd. as shown

A silver DEEP-1 magnet bears N. 45° E., 10 lks. dist., 12 ins. below the ground.


An orange DEEP-1 magnet bears N. 45° W., 10 lks. dist., 12 ins. below the ground.

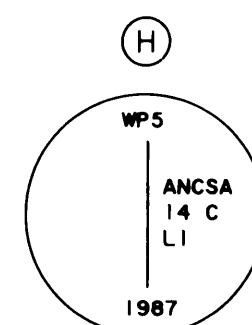

Drive an alum. rod, 12 ft. long, 3/4 in. diam., 11.5 ft. in the ground, with alum. cap mkd. as shown, from which


A spruce, 8 ins. diam., bears N. 60 3/4° E., 103 lks. dist., mkd. X BT.

A spruce, 6 ins. diam., bears N. 21 1/2° W., 23 lks. dist., mkd. X BT.

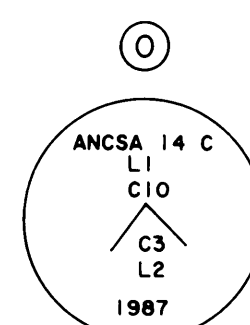


Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.7 ft. in the ground, with alum. cap mkd. as shown

No suitable accessories available, pits impractical.

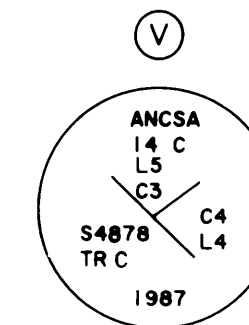

Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.5 ft. in the ground, with alum. cap mkd. as shown


No suitable accessories available, pits impractical.

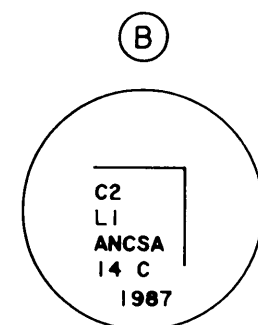

Set an alum. post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with alum. cap mkd. as shown, from which

A spruce, 8 ins. diam., bears S. 78 3/4° W., 67 lks. dist., mkd. X BT.


A spruce, 6 ins. diam., bears N. 21 1/4° W., 41 lks. dist., mkd. X BT.

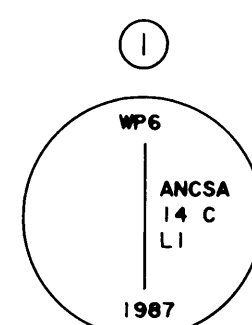

Drive an alum. rod, 15 ft. long, 3/4 in. diam., 14.3 ft. in the ground, with alum. cap mkd. as shown, from which


A spruce, 5 ins. diam., bears S. 52 1/4° E., 104 lks. dist., mkd. X BT.

A spruce, 5 ins. diam., bears S. 61 1/4° W., 42 lks. dist., mkd. X BT.

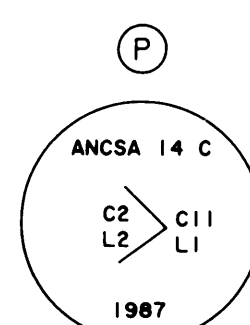


Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.7 ft. in the ground, with alum. cap mkd. as shown

No suitable accessories available, pits impractical.

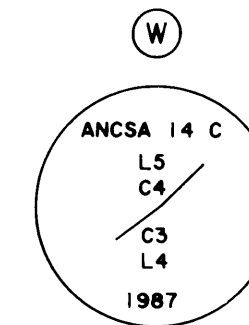

Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8 ft. in the ground, with alum. cap mkd. as shown


No suitable accessories available, pits impractical.

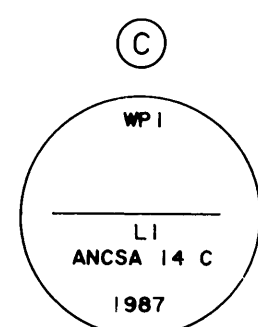

Set an alum. post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with alum. cap mkd. as shown, from which

A spruce, 5 ins. diam., bears S. 25 1/4° E., 96 lks. dist., mkd. X BT.


A spruce, 4 ins. diam., bears S. 40° W., 125 lks. dist., mkd. X BT.

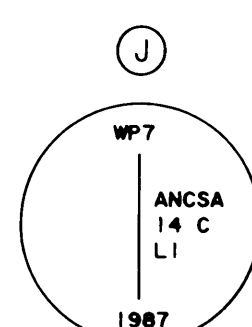

Drive an alum. rod, 12 ft. long, 3/4 in. diam., 11.5 ft. in the ground, with alum. cap mkd. as shown, from which


A spruce, 7 ins. diam., bears S. 5 1/2° E., 69.5 lks. dist., mkd. X BT.

A spruce, 7 ins. diam., bears S. 78 1/4° W., 58 lks. dist., mkd. X BT.

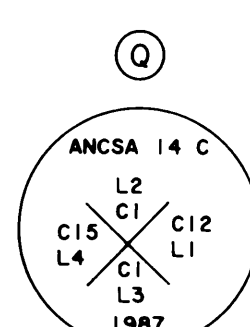


Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.7 ft. in the ground, with alum. cap mkd. as shown

No suitable accessories available, pits impractical.

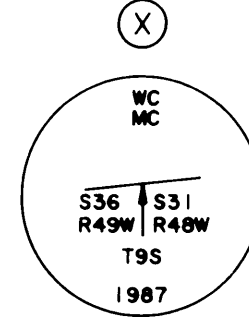

Recovered an alum. rod, 3/4 in. diam., firmly set, projecting 12 ins. above the ground, with alum. cap mkd. as shown


No accessories recovered.

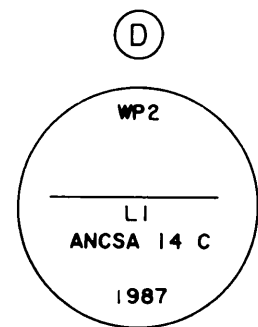

Set an alum. post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with alum. cap mkd. as shown, from which

A spruce, 7 ins. diam., bears S. 22 3/4° E., 130.5 lks. dist., mkd. X BT.


A spruce, 8 ins. diam., bears N. 79 1/2° W., 137.5 lks. dist., mkd. X BT.

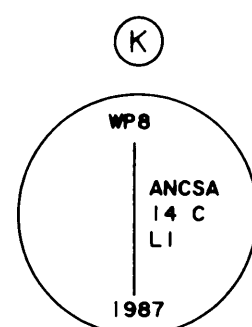

Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.3 ft. in the ground, with alum. cap mkd. as shown, from which


A spruce, 5 ins. diam., bears S. 73 1/2° E., 26.5 lks. dist., mkd. X BT.

A spruce, 4 ins. diam., bears S. 1 1/4° W., 41 lks. dist., mkd. X BT.

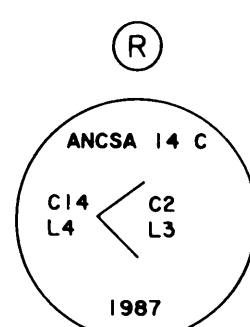


Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.5 ft. in the ground, with alum. cap mkd. as shown

No suitable accessories available, pits impractical.

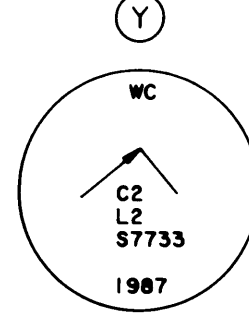

Recovered an alum. post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above the ground, with alum. cap mkd. as shown


No accessories recovered.

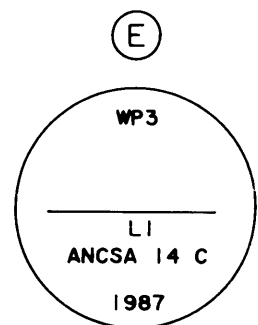

Set an alum. post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with alum. cap mkd. as shown, from which

A spruce, 7 ins. diam., bears N. 19 1/2° E., 83 lks. dist., mkd. X BT.


A spruce, 11 ins. diam., bears S. 50° E., 134 lks. dist., mkd. X BT.

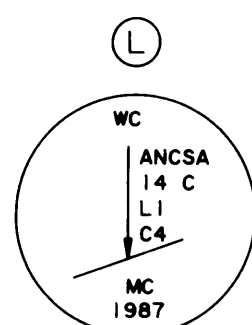

Set an alum. post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with alum. cap mkd. as shown, from which


A spruce, 5 ins. diam., bears S. 60 1/4° W., 116 lks. dist., mkd. X BT.

A spruce, 10 ins. diam., bears N. 10 1/2° W., 137 lks. dist., mkd. X BT.

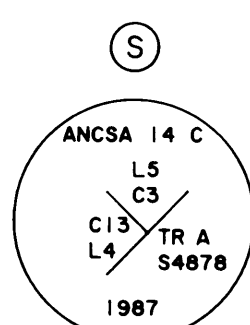


Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8 ft. in the ground, with alum. cap mkd. as shown

No suitable accessories available, pits impractical.

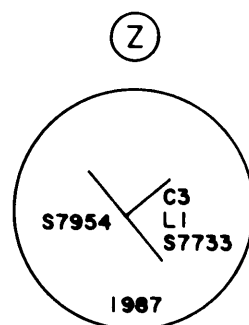

Recovered an alum. post, 2 1/2 ins. diam., firmly set, projecting 2 ins. above the ground, with alum. cap mkd. as shown


No accessories recovered.

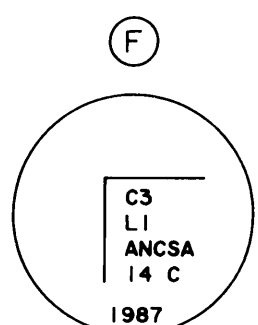

Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.5 ft. in the ground, with alum. cap mkd. as shown, from which


A spruce, 5 ins. diam., bears S. 42 1/4° E., 109 lks. dist., mkd. X BT.

A spruce, 7 ins. diam., bears S. 45 1/2° W., 80 lks. dist., mkd. X BT.

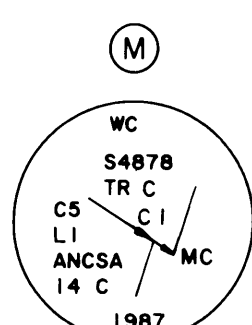


Recovered an alum. post, 2 1/2 ins. diam., firmly set, projecting 2 ins. above the ground, with alum. cap mkd. as shown, add marks C5 L1 ANCSA 14C

No suitable accessories available, pits impractical.

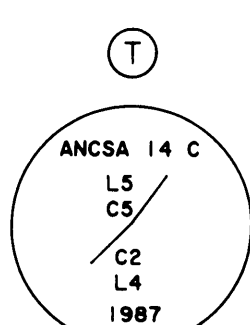

Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8 ft. in the ground, with alum. cap mkd. as shown


No suitable accessories available, pits impractical.

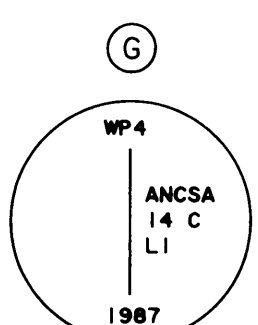

Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.3 ft. in the ground, with alum. cap mkd. as shown, from which


A birch, 9 ins. diam., bears N. 12° E., 51.5 lks. dist., mkd. X BT.

A spruce, 3 ins. diam., bears N. 63 3/4° W., 36.5 lks. dist., mkd. X BT.

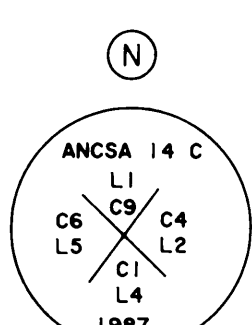

Drive an alum. rod, 9 ft. long, 3/4 in. diam., 9.3 ft. in the ground, with alum. cap mkd. as shown

No suitable accessories available, pits impractical.

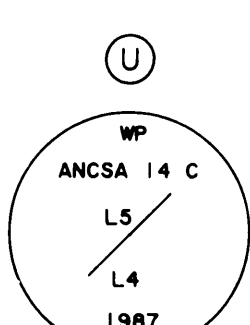

Drive an alum. rod, 9 ft. long, 3/4 in. diam., 8.3 ft. in the ground, with alum. cap mkd. as shown

No suitable accessories available, pits impractical.

REFERENCE SHOULD BE MADE TO SHEET NO. 1
FOR SURVEY INFORMATION

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Anchorage, Alaska

The survey represented by this plat, having been properly executed and examined, is hereby accepted for having fulfilled the intent of Section 14(c) of the Alaska Native Claims Settlement Act.

For the Director

Must C. Jones
Deputy State Director for Cadastral Survey,
Alaska
ACTING


May 16, 1989
Date

89-7


RECORDED - FILED	35
<i>Bristol Bay</i>	cc
DATE <i>5-18</i>	19 <i>89</i>
TIME <i>3:10</i>	<i>P.M.</i>
Requested by <i>USA/ALM</i>	
Address	

ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(C), LOTS 1 THROUGH 5
(P.L. 92-203, 85 STAT. 703)
EKWOK NATIVES, LIMITED

EKWOK, ALASKA

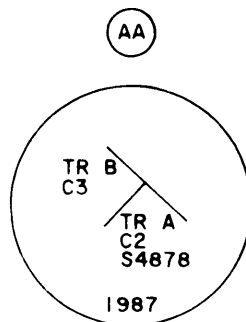


Found a Copperweld monument, firmly set, projecting 2 ins. above the ground, with top mkd. as shown

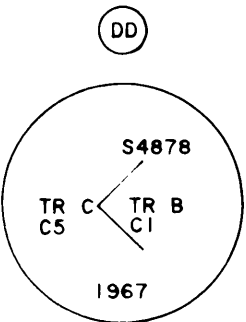


Found an iron post, 2 1/2 ins. diam., firmly set, projecting 3 ins. above the ground, with brass cap mkd. as shown

No search made for accessories.

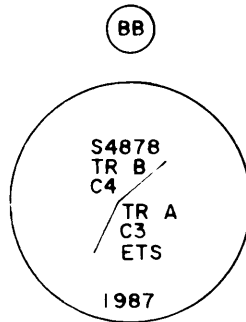


Found a Copperweld monument, firmly set, projecting 2 ins. above the ground, with top mkd. as shown

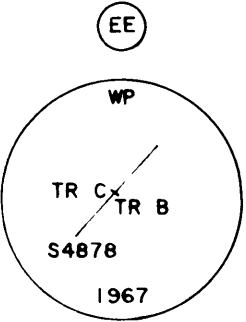


Found an iron post, 2 1/2 ins. diam., firmly set, projecting 5 ins. above the ground, with brass cap mkd. as shown

No search made for accessories.

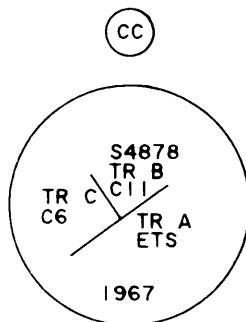

Found an iron post, 2 1/2 ins. diam., firmly set, projecting 3 ins. above the ground, with brass cap mkd. as shown

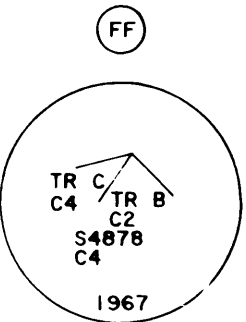

Found an iron post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above the ground, with brass cap mkd. as shown

No search made for accessories.

89-7
RECORDED - FILED 35-
Bristol Bay REC. DIST. cc
DATE 5-18 1989
TIME 3:10 P M
Requested by
Address USA/BLM

REFERENCE SHOULD BE MADE
TO
SHEET NO. 1
FOR SURVEY INFORMATION

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Anchorage, Alaska

The survey represented by this plat, having been properly executed and examined, is hereby accepted for having fulfilled the intent of Section 14(c) of the Alaska Native Claims Settlement Act.

For the Director

May 16, 1989
Date
J. J. C. Jones
Deputy State Director for Cadastral Survey,
Alaska
ATTN: